

**Flood Control Project Maintenance
Levee Inspections**

Fall 2008 Levee Maintenance Deficiency Summary Report

Overall LMA & Unit Ratings, including Boat Survey Erosion

San Joaquin River Basin

RD2095	Overall LMA Rating	Total LMA Miles				
Reclamation District No. 2095	U	4.90				
Rated Item	M Miles	U Miles	M + 4U Miles	Threshold %	Encroachments	
					PO Miles	CO Miles
Vegetation	1.82		1.82	37.14%		
Trim / Thin Trees	0.72		0.72	14.69%		
Encroachments	0.02		0.02	0.41%		
Erosion / Bank Caving	0.81		0.81	16.53%		
Boat Survey Erosion	0.01	0.06	0.25	5.10%		
<i>LMA Totals:</i>	3.38	0.06	3.62	73.88%	0.00	0.00

Unit No. 01 Paradise Cut	Overall Unit Rating	Total Unit Miles				
	U	1.50				
Rated Item	M Miles	U Miles	M + 4U Miles	Threshold %	Encroachments	
					PO Miles	CO Miles
Encroachments	0.02		0.02	1.33%		
Erosion / Bank Caving	0.60		0.60	40.00%		
Boat Survey Erosion		0.02	0.08	5.33%		
<i>Unit Totals:</i>	0.62	0.02	0.70	46.67%	0.00	0.00

Unit No. 02 San Joaquin River	Overall Unit Rating	Total Unit Miles				
	U	3.40				
Rated Item	M Miles	U Miles	M + 4U Miles	Threshold %	Encroachments	
					PO Miles	CO Miles
Vegetation	1.82		1.82	53.53%		
Trim / Thin Trees	0.72		0.72	21.18%		
Erosion / Bank Caving	0.21		0.21	6.18%		
Boat Survey Erosion	0.01	0.04	0.17	5.00%		
<i>Unit Totals:</i>	2.76	0.04	2.92	85.88%	0.00	0.00

**Flood Control Project Maintenance
Levee Inspections**
LMA District Cover Sheet
Fall 2008 Levee Inspection Results

Reclamation District No. 2095

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)			U	

** Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

*
SPRING INSPECTIONS: Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports.

Comments

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Fall 2008 Levee Inspection Results

Reclamation District No. 2095

Waterway			Bank	Unit Miles
Unit No. 01 Paradise Cut			Left	1.50
	Spring (March - May)	Summer (June - August)	Fall (September - November)	Winter (December - February)
Date of Inspection	5/7/2008		9/18/2008	
DWR Inspector	Bob Duffey		Hana Babbin	
Accompanied By				
Unit Maintenance Rating (Fall Only)			U	

Check one:

- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. We have found no changes in flood project conditions other than the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the enclosed report.
- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. In addition to the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the report, we have found the following changes in flood project conditions.

(In the comment section below or on additional sheet(s), identify change of condition by: Start to End Levee Mile or GPS coordinates, location (Land Side, Water Side, or Crown), Item identification, and description of the current condition).

Comments

One of the boxes above is to be checked by the Local Maintaining Agency (LMA). If the second box is checked, additional information must also be submitted. This Unit Cover Sheet should be signed and dated by the LMA Representative and returned to DWR with any additional sheets by September 30 (Summer Inspection) or March 31 (Winter Inspection). Please retain a copy for your records. Please mail all of this information to :

DWR Summer/Winter Inspection Reports
3310 El Camino Avenue, Room LL-30
Sacramento, CA 95821-9000.

X

Signature of LMA Representative

Date

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Fall 2008

Reclamation District No. 2095

Waterway							Bank	Unit Miles	Inspection Date	Inspector	
Unit No. 01 Paradise Cut							Left	1.50	09/18/2008	Hana Babbins	
LMR Line	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Photo	Issue
	Start	End						Start	End		
1	0.00	0.60	Earthen Levee	Erosion / Bank Caving	LS	M	Note and monitor erosion site.	°	°	Y	5
2	0.73	0.73	Boat Survey	Boat Survey Erosion	LS	U	Inspector Comments: Downstream of WPRR near siphon pipe & pump; sandy levee; visited by Jeff Van Gilder and LRO in 2008 for assessment	37.763630 ° -121.319000 °	°	°	934
3	0.86	0.86	Boat Survey	Boat Survey Erosion	LS	U	Inspector Comments: Previous erosion site that is now partially protected with concrete rubble	37.761960 ° -121.318140 °	°	°	935
4	0.88	0.88	Earthen Levee	Encroachments	WS	M	Pipe	37.761782 ° -121.317893 °	37.761782 ° -121.317893 °	Y	6
5	1.27	1.27	Earthen Levee	Encroachments	LS	M	Tree or limb	37.759403 ° -121.312347 °	37.759403 ° -121.312347 °		3

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Fall 2008

Reclamation District No. 2095

Waterway	Bank	Unit Miles	Inspection Date	Inspector
Unit No. 01 Paradise Cut	Left	1.50	09/18/2008	Hana Babbins

Levee Mile Report Line	1
Start Levee Mile	0.00
End Levee Mile	0.60
Location	
Category	Earthen Levee
Item	Erosion / Bank Caving
RD 2095 unit 1 , LM 0 to 0.6 erosion on the LS requires attention.	



Levee Mile Report Line	4
Start Levee Mile	0.88
End Levee Mile	0.88
Location	
Category	Earthen Levee
Item	Encroachments
LM .88 RD 2095 unit 1 Paradise Cut. Pipe on WS should be removed. Failure to do so may encourage, simply by example, additional equipment to be left on the levee for 'later' removal.	

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Fall 2008 Levee Inspection Results

Reclamation District No. 2095

Waterway			Bank	Unit Miles
Unit No. 02 San Joaquin River			Left	3.40
	Spring (March - May)	Summer (June - August)	Fall (September - November)	Winter (December - February)
Date of Inspection	5/7/2008		9/18/2008	
DWR Inspector	Bob Duffey		Hana Babbin	
Accompanied By				
Unit Maintenance Rating (Fall Only)			U	

Check one:

- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. We have found no changes in flood project conditions other than the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the enclosed report.
- ☐ During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. In addition to the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the report, we have found the following changes in flood project conditions.

(In the comment section below or on additional sheet(s), identify change of condition by: Start to End Levee Mile or GPS coordinates, location (Land Side, Water Side, or Crown), Item identification, and description of the current condition).

Comments

One of the boxes above is to be checked by the Local Maintaining Agency (LMA). If the second box is checked, additional information must also be submitted. This Unit Cover Sheet should be signed and dated by the LMA Representative and returned to DWR with any additional sheets by September 30 (Summer Inspection) or March 31 (Winter Inspection). Please retain a copy for your records. Please mail all of this information to :

DWR Summer/Winter Inspection Reports
3310 El Camino Avenue, Room LL-30
Sacramento, CA 95821-9000.

X

Signature of LMA Representative

Date

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Fall 2008

Reclamation District No. 2095

Waterway						Bank	Unit Miles	Inspection Date		Inspector	
Unit No. 02 San Joaquin River						Left	3.40	09/18/2008		Hana Babbins	
LMR Line	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Photo	Issue
	Start	End						Start	End		
1	0.05	1.42	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes.	37.759298 ° -121.308283 °	37.744173 ° -121.298105 °		1
2	0.08	0.40	Earthen Levee	Trim / Thin Trees	WS	M	Trim trees to at least five feet above ground level.	37.759027 ° -121.307865 °	37.754932 ° -121.305608 °		2
3	0.13	0.13	Boat Survey	Boat Survey Erosion	WS	M	Inspector Comments: Minor sinkhole at edge of crown road; approximately 200 ft of berm	37.758470 ° -121.307150 °	° °		936
4	0.14	0.14	Earthen Levee	Erosion / Bank Caving	WS	M	Note and monitor erosion site.	37.758647 ° -121.306953 °	37.758647 ° -121.306953 °	Y	17
5	0.27	0.31	Earthen Levee	Vegetation	WS	M	Elderberries are blocking visibility and flood fight capability.	37.756723 ° -121.305948 °	37.756247 ° -121.305585 °		5
6	0.51	0.56	Earthen Levee	Vegetation	WS	M	Elderberries are blocking visibility and flood fight capability.	37.753487 ° -121.305403 °	37.752807 ° -121.304960 °		3
7	0.57	0.62	Earthen Levee	Erosion / Bank Caving	LS	M	Note and monitor erosion site.	37.752703 ° -121.304848 °	37.752130 ° -121.304377 °		4
8	0.65	0.65	Earthen Levee	Vegetation	LS	M	Elderberries are blocking visibility and flood fight capability.	37.751545 ° -121.304308 °	37.751545 ° -121.304308 °		6
9	0.93	1.04	Earthen Levee	Vegetation	WS	M	Elderberries are blocking visibility and flood fight capability.	37.749513 ° -121.300770 °	37.749440 ° -121.298938 °		7
10	0.94	0.94	Earthen Levee	Trim / Thin Trees	WS	M	Trim trees to at least five feet above ground level.	37.749592 ° -121.300582 °	37.749592 ° -121.300582 °		8
11	1.04	1.42	Earthen Levee	Trim / Thin Trees	WS	M	Trim trees to at least five feet above ground level.	37.749247 ° -121.298847 °	37.744168 ° -121.298098 °		9
12	1.24	1.29	Earthen Levee	Vegetation	WS	M	Elderberries are blocking visibility and flood fight capability.	37.746462 ° -121.298780 °	37.745868 ° -121.298207 °		10
13	1.51	1.67	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes.	37.743137 ° -121.297780 °	37.741187 ° -121.296255 °		11
14	1.54	1.54	Earthen Levee	Vegetation	WS	M	Elderberries are blocking visibility and flood fight capability.	37.742828 ° -121.297532 °	37.742828 ° -121.297532 °		12
15	1.59	1.59	Earthen Levee	Trim / Thin Trees	WS	M	Trim trees to at least five feet above ground level.	37.742295 ° -121.297083 °	37.742295 ° -121.297083 °		13
16	1.81	1.81	Earthen Levee	Erosion / Bank Caving	LS	M	Schedule repair of erosion site prior to the next inspection.	37.739710 ° -121.297943 °	37.739710 ° -121.297943 °	Y	18
17	1.85	1.89	Boat Survey	Boat Survey Erosion	LS	U	Inspector Comments: Just upstream of where berm begins	37.738880 ° -121.298260 °	° °		937
18	2.04	2.04	Earthen Levee	Erosion / Bank Caving	LS	M	Note and monitor erosion site.	37.736543 ° -121.298192 °	37.736543 ° -121.298192 °		16
19	2.04	2.04	Earthen Levee	Vegetation	LS	M	Elderberries are blocking visibility and flood fight capability.	37.736543 ° -121.298192 °	37.736543 ° -121.298192 °		15

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Fall 2008

Reclamation District No. 2095

Waterway						Bank	Unit Miles	Inspection Date	Inspector	
Unit No. 02 San Joaquin River						Left	3.40	09/18/2008	Hana Babbitt	

LMR Line	Levee Mile		Category	Item	Location *	Rating **	Action/Comment	GPS Latitude/Longitude		Photo	Issue
	Start	End						Start	End		
20	2.04	2.04	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes.	37.736543 ° -121.298192 °	37.736540 ° -121.298190 °		14
21	2.14	2.27	Earthen Levee	Erosion / Bank Caving	LS	M	Note and monitor erosion site.	37.735113 ° -121.297733 °	37.733210 ° -121.297253 °	Y	19

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Fall 2008

Reclamation District No. 2095

Waterway	Bank	Unit Miles	Inspection Date	Inspector
Unit No. 02 San Joaquin River	Left	3.40	09/18/2008	Hana Babbin

Levee Mile Report Line	4
Start Levee Mile	0.14
End Levee Mile	0.14
Location	
Category	Earthen Levee
Item	Erosion / Bank Caving
RD 2095 unit2. WS bank caving at LM 0.14.	



Levee Mile Report Line	16
Start Levee Mile	1.81
End Levee Mile	1.81
Location	
Category	Earthen Levee
Item	Erosion / Bank Caving
RD 2095 unit2. LS caving, quite large. Should be repaired ASAP. Possible threat especially during any flood fight attempt in this area.	



Levee Mile Report Line	16
Start Levee Mile	1.81
End Levee Mile	1.81
Location	
Category	Earthen Levee
Item	Erosion / Bank Caving
Another view.	

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Fall 2008

Reclamation District No. 2095

Waterway	Bank	Unit Miles	Inspection Date	Inspector
Unit No. 02 San Joaquin River	Left	3.40	09/18/2008	Hana Babbins

Levee Mile Report Line	21
Start Levee Mile	2.14
End Levee Mile	2.27
Location	
Category	Earthen Levee
Item	Erosion / Bank Caving
Rd 2095 unit 2. LS erosion and bank caving.	

*** Location**

LS : Land Side
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable PO : Partially Obstructing
M : Minimally Acceptable CO : Completely Obstructing
U : Unacceptable N : Not Inspected